

**Read Before Installing
MPE/iX Release 7.5 PowerPatch 2
Software Release (C.75.02)**

HP e3000 MPE/iX Computer Systems

Edition 3



Manufacturing Part Number: 30216-90351

E0604

U.S.A. June 2004

Notice

The information contained in this document is subject to change without notice.

Hewlett-Packard makes no warranty of any kind with regard to this material, including, but not limited to, the implied warranties of merchantability or fitness for a particular purpose. Hewlett-Packard shall not be liable for errors contained herein or for direct, indirect, special, incidental or consequential damages in connection with the furnishing or use of this material.

Hewlett-Packard assumes no responsibility for the use or reliability of its software on equipment that is not furnished by Hewlett-Packard.

This document contains proprietary information which is protected by copyright. All rights reserved. Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

Restricted Rights Legend

Use, duplication, or disclosure by the U.S. Government is subject to restrictions as set forth in subparagraph (c) (1) (ii) of the Rights in Technical Data and Computer Software clause at DFARS 252.227-7013. Rights for non-DOD U.S. Government Departments and Agencies are as set forth in FAR 52.227-19 (c) (1,2).

Acknowledgments

UNIX is a registered trademark of The Open Group.

Hewlett-Packard Company
3000 Hanover Street
Palo Alto, CA 94304 U.S.A.

© Copyright 2004 by Hewlett-Packard Company.

1. Information You Need Before Installing MPE/iX 7.5 PowerPatch 2

Important CR Information	5
CR# JAGae78289 / 8606315566	5
CR# JAGaf26937 / 860636633	6
Predictive Changes SYSSTART during UPDATE	7
Host-Based DTC Management Features	8
Samba 2.2.8a / SMBMXG3C	10
Migrating from Samba 2.0.7	10
Migrating Back to Samba 2.0.7	11
WebWise Apache in FOS	12
Migrating from Previous Versions of Apache	12
Migrating from WebWise A.01.00	12

2. Patch Information for MPE/iX 7.5 PowerPatch 2

1 Information You Need Before Installing MPE/iX 7.5 PowerPatch 2

Important CR Information

Please take note of the updated CR information.

CR# JAGae78289 / 8606315566

:STMSHUT sometimes unable to completely close daemon

During certain installations of the PowerPatch, an installation job has been found to fail due to the inability of the diagnostic monitor to completely shutdown. The symptom of the problem is that the job I0231900 will abort, which will trigger the installing tool (usually HPINSTAL) to systematically abort. Within the spoolfile of this jobstream, the following failure text is seen:

```
:purge /usr/lib/libmcats.sl  
EXCLUSIVE VIOLATION: FILE ACCESSED EXCLUSIVELY (FSERR 91)  
Unable to purge file "/usr/lib/libmcats.sl". (CIERR 384)  
REMAINDER OF JOB FLUSHED.
```

This condition can be resolved, and the installation can be resumed, by following these steps (user entries are in bold below):

1. Kill the diagmond daemon.

From **MANAGER.SYS**,

```
:run sh.hpbin.sys  
$ ps -ef | grep diagmond
```

The above command should return a line similar to this:

```
0 65584 1 0 Jan 01 1:10 /usr/sbin/stm/uut/bin/sys/diagmond  
^^^^^
```

Note this number. It is the pid number of the process that needs to be killed. Issue the kill command for this pid:

```
$kill 65584 (for pid# 65584)
```

Now, verify that the process has been aborted, by repeating the 'ps' command:

```
$ ps -ef | grep diagmond
```

There should not be any entries returned. Merely a line-feed. If the entry is still showing, use this kill command:

```
$kill -9 65584 (for pid# 65584)
```

2. Resume the installation. Simply run the installer program again. Make sure you are in the **INSTALL** group, and issue the run command.

```
:run hpinstal
```

The installation process will detect where it left off, and will resume from that point.

CR# JAGaf26937 / 860636633

TermDSM C.05.01.002 port reset doesn't work when auto-restart = 'Y'

One of the new features added to Host-based DTC Management is the ability to enable automatic restart of the X.25 and PAD protocols on the SNP cards installed in the DTCs. This feature is enabled by setting the field "AutoRestart = 'Y'" on the DTC configuration screen in NMMGR. A problem has been found when this feature is enabled.

If TermDSM is used to initiate a DTC DUMP on a DTC where the Auto-Restart feature is enabled, then TermDSM displays the following error after the dump is completed, but before TermDSM returns to the user prompt:

```
***** TERMDSM C.05.01.002      UNEXPECTED CONDITION *****
Severity=non-fatal Location=9 Reporting module is Special.

Parm1= hex 000000C9= decimal 201
Parm2= hex 0000003C= decimal 60
Parm3= hex FFFFFFFE48= decimal -440
Parm4= hex 00000001= decimal 1
Parm5= hex FFFFFFFF= decimal -65537
Parm6= hex 000001CC= decimal 460
```

After this message is displayed, the following problems will occur:

- The DTC will not be able to establish any X.25 or PAD connections.
- TermDSM will not be able to communicate with the DTC Manager and messages similar to the one shown above will be displayed. The error display will include the following line:

```
Severity=non-fatal Location=9 Reporting module is Special.
```
- DTCCONTL will not be able to communicate with the DTC Manager and will hang for about 8 minutes and then return the following error:

```
CTL ERROR: System error: bad Extend_receive status received,
           info = 1010, subsys = 122. (CTLERR 106)
```

These problems will persist until the DTC is reset by cycling the power OFF then ON. Once the DTC is power cycled, the DTC will be automatically re-downloaded. The DTC download is complete when you see the following messages on the system console:

```
19:13/40/DTCM C0501001 download started for DTC address 080009xxxxxx
19:14/40/DTCM C0501001 code download completed for DTC address 080009xxxxxx
```

The DTC will be able to re-establish X.25 and PAD connections about three minutes after these messages are displayed.

Predictive Changes SYSSTART during UPDATE

Due to some customer sites having multiple startup directives in SYSSTART.PUB.SYS, the job that installs Predictive has been modified to recognize this. Previously, this Predictive job would just add the "STREAM JPSMON.PRED.SYS" line to the end of SYSSTART. Now, the job modifies the SYSSTART file as follows:

1. Gather STREAMs device and printer queue for STREAMs and OPENQ commands if needed.
2. If SYSSTART.PUB.SYS does not exist, a new SYSSTART file is created on ldev 1 with the following contents:

```
STARTUP
**
WARMSTART
OPENQ LP
STREAMS 10
STREAM JPSMON.PRED.SYS
**
COOLSTART
OPENQ LP
STREAMS 10
STREAM JPSMON.PRED.SYS
****
```

3. If a WARMSTART, COOLSTART, RELOAD or UPDATE section exists and has commands, AND there are no other STREAM commands AND there are no STARTSESS to OPERATOR.SYS commands, then do not modify the SYSSTART file.
4. If there are STARTSESS commands but no STARTSESS to OPERATOR.SYS, then do not modify the SYSSTART file.
5. The command STREAM JPSMON.PRED.SYS is removed from the STARTUP section and added to the WARMSTART and COOLSTART sections. If no WARMSTART and COOLSTART sections exist, they are created and contain these commands:

```
**
WARMSTART
OPENQ LP
STREAMS 10
STREAM JPSMON.PRED.SYS
**
COOLSTART
OPENQ LP
STREAMS 10
STREAM JPSMON.PRED.SYS
****
```

If the file NOSYSST.PRED.SYS exists, it prevents the Predictive job from doing any SYSSTART file processing during installation. Therefore, if you do NOT want the "STREAM JPSMON.PRED.SYS" command added to your SYSSTART file, create the NOSYSST.PRED.SYS file with a build command.

```
BUILD NOSYSST.PRED.SYS;DISC=1
```

Host-Based DTC Management Features

As you may be aware, the Open View DTC Manager (OVDTCMgr) application on the PC was discontinued October 2002. In MPE/iX 7.5 Power Patch 2, the DTS subsystem has been enhanced to provide functionality needed to continue support of the DTC connectivity required by the HP e3000 users. The features added to the DTS subsystem had previously been available when the OVDTCMgr platform managed the DTCs and PC-Based Management was configured on the HPe3000, but not when the HP e3000 host managed the DTCs and Host-Based Management was configured.

These enhancements required changes to the data structures for the DTS subsystem in the NMCONFIG file and some NMMGR screens. These enhancements have been designed to minimize the additional steps you need to do to install and migrate to this release. This article describes some features and behaviors of this version of the DTS subsystem that you should know about before you install this release. These important features and behaviors are the following:

- Although it is now an unsupported configuration, the OVDTCMgr platform will still be able to manage the DTCs for connection to the HP e3000. HP recommends that you migrate your DTS configuration to Host-Based management at the earliest opportunity.
- When you reboot your system after updating with this release, DTS will recognize that the data in the DTS subsystem of the NMCONFIG file is in the old format but will still create a valid DTS configuration. DCC will display the following warning message.

```
DCC WARNING P-L, NMCONFIG is previous version. Run NMMGRVER. (DCCWARN 52)
```

The DTS configuration created will be identical to what was created prior to the update.

- In NMMGR, if you press the **[DTS]** key at the Main screen and attempt to display the DTS configuration before running NMMGRVER, instead of going to the DTS configuration screen, you will see a screen that informs you that the DTS subsystem has been updated. The actions you can take are described later in this article.
- You will use the version of NMMGRVER installed with this release to update the NMCONFIG file to the latest format and then perform a DTS Shutdown and Restart.
- After using NMMGRVER to migrate the configuration file to the latest format, DTS Dynamic Configuration will be disabled until a DTS Shutdown and Restart or system reboot is performed.

Use one of the following two processes described below to update the NMCONFIG file so that NMMGR will allow you to make new changes to the DTS configuration and to re-enable DTS Dynamic Configuration.

1. Run NMMGRVER from the Command Interpreter.

You can run NMMGRVER from the CI as you have on earlier releases to update the format of the NMCONFIG file:

- a. Run NMMGRVER to update the NMCONFIG file to the latest format:

```
:run nmmgrver.pub.sys
Utility to convert NM configuration files to be compatible with NMMGR B.07.06.
Fileset to be scanned? NMCONFIG.PUB.SYS
(Enter the file name of your NM configuration file. Then confirm the conversion.)
OK to convert NMCONFIG.PUB.SYS? Y
```

- b. Perform a DTS Shutdown and Restart:

```
:dtccntrl func=shutdown forced=y
:dtccntrl func=restart
```

2. Run NMMGRVER from within NMMGR.

You can run `NMMGRVER` from within `NMMGR` to update the `NMCONFIG` file and continue with changes to the DTS configuration without leaving `NMMGR`:

- a. Run `NMMGR` and press the `[DTS]` key at the Main `NMMGR` screen, you will see a screen that informs you that the DTS subsystem has been updated. Press the `F1 [Do Convert]` key. This key will launch `NMMGRVER` and you will see:

```
Utility to convert NM configuration files to be compatible with NMMGR B.07.06.  
Fileset to be scanned? NMCONFIG.PUB.SYS
```

(Enter the file name of your NM configuration file. Then confirm the conversion.)

```
OK to convert NMCONFIG.PUB.SYS? Y
```

- b. Note the dialog on the screen to verify that the conversion was successful and enter `[Return]` to return to `NMMGR`.
- c. Press the `[Prior Screen]` key to return to the Main `NMMGR` screen and then press the `[DTS]` key to resume your DTS configuration changes.
- d. Validate the `NMCONFIG` file and exit `NMMGR`.
- e. Perform a DTS Shutdown and Restart in order for the configuration changes to take:

```
:dtccntrl func=shutdown forced=y  
:dtccntrl func=restart
```

After you run `NMMGRVER` and if your system is using Host-Based Management, your data will be converted to the equivalent configuration in the new format. If your system is currently using PC-Based Management, you will see no changes to your configuration.

For more information on the features and behaviors of these enhancements, see the article "Enhanced Host-based DTC Management Functionality" in the *Communicator for MPE/iX Release 7.5 Power Patch 2*.

Complete documentation and information to help you migrate your configuration to Host-Based Management can be found in the updated *Configuring and Managing Host-Based X.25 Links* manual that is available online from:

<http://www.docs.hp.com/mpeix/onlinedocs/36939-90057/36939-90057.pdf>

Samba 2.2.8a / SMBMXG3C

Migrating from Samba 2.0.7

Users of Samba 2.0.7 need to be aware of the following issues before installing Samba 2.2.8a. For complete information about Samba 2.2.8a, please see <http://jazz.external.hp.com/src/samba/> (or [/usr/local/samba/ReadME.mpe](#) after this patch has been installed).

Streamlined Installation Layout (Some Files Have Moved)

Previous versions of Samba installed a few files into the `SAMBA.SYS` group and the remaining files into the `SAMBA` account. Starting with Samba 2.2.8a, all files are now installed into the `SAMBA` account in a version-specific group, i.e. `SMB228A.SAMBA`. The Samba 2.2.8a installation script does not modify any of the old Samba files in the `SAMBA.SYS` group.

The Samba 2.2.8a installation script modifies the `/usr/local/samba` symbolic link to point to the new `/SAMBA/SMB228A` file location. A new symbolic link of `/SAMBA/CURRENT` is created to point to the same location.

If you have any jobs, UDCs or command files, etc that refer to the old `SAMBA.SYS` files, you must modify these old references to point to the new file locations. Use either of the symbolic links to do this. That is, instead of `SMBD.SAMBA.SYS`, you can refer to `SMBD.CURRENT.SAMBA` or `/usr/local/samba/SMBD` or `/SAMBA/CURRENT/SMBD`.

Existing 2.0.7 Configuration Files are Compatibles with 2.2.8a

Your existing 2.0.7 configuration files are compatible with 2.2.8a. Copy them from the old `/SAMBA/SMB207/lib` location to `/usr/local/samba/lib` or `/SAMBA/CURRENT/lib`.

In order to take full advantage of the new 2.2.8a functionality, it is recommended that you use `/usr/local/samba/lib/samp-smb.conf` as a template for creating a new `smb.conf` file.

New "Full-Power" Model Enabled by Default

Previous versions of Samba for MPE required manually adding PM capability to the `MGR.SAMBA` user in order to enable "full-power mode" where Samba can authenticate against traditional MPE user and account passwords of the format `USERPW, ACCTPW`. This functionality is now enabled by default starting with Samba 2.2.8a.

Full-power mode is the recommended mode of operation. Besides the convenience of authenticating against traditional MPE passwords, full-power mode also enables Samba to `setuid()` to the authenticated user so that all file accesses occur with the authenticated user's access rights

Full-power mode under Samba 2.2.8a is enabled for Samba program files if they are owned by `MANAGER.SYS` but reside in the `SAMBA` account. The full-power program files are currently `NMBD`, `SMBD`, and `SWAT`. Since PM capability on the `MGR.SAMBA` user is no longer required for full-power mode, it is removed by the Samba 2.2.8a installation script.

Migrating Back to Samba 2.0.7

If after installing Samba 2.2.8a, you decide that you want to migrate back to Samba 2.0.7, perform the following steps:

```
:HELLO MANAGER.SYS  
:PURGELINK /usr/local/samba  
:NEWLINK /usr/local/samba,/SAMBA/SMB207  
:ALTUSER MGR.SAMBA;CAP=+PM
```

(if you were previously using Samba 2.0.7 in full power mode)

WebWise Apache in FOS

For MPE/iX 7.5, WebWise server has been updated to version A.03.00 and replaces Apache in FOS as a no-extra-cost bundled product.

Migrating from Previous Versions of Apache

The `/APACHE/PUB/JHTTPD` job stream file from previous versions of Apache is not compatible with HP WebWise MPE/iX Secure Web Server. You must manually create a new `JHTTPD` job stream file by using the WebWise `/APACHE/PUB/JHTTPD.sample` template.

The `/APACHE/PUB/conf/httpd.conf` configuration file from previous versions of Apache may or may not be compatible with WebWise, depending on the previous Apache version:

- 1.3.4 -- NOT compatible. You must use `/APACHE/PUB/conf/httpd.conf.sample` as a template to create a new `httpd.conf` file.
- 1.3.9 -- compatible, but SSL functionality will not be enabled. To enable SSL functionality, you MUST use `/APACHE/PUB/conf/httpd.conf.sample` as a template to create a new `httpd.conf` file.
- 1.3.14 -- compatible, but SSL functionality will not be enabled. To enable SSL functionality, you MUST use `/APACHE/PUB/conf/httpd.conf.sample` as a template to create a new `httpd.conf` file.

In addition to updating `/APACHE/PUB/conf/httpd.conf`, it is strongly recommended to update all of the configuration files in the same directory by using the corresponding `*.sample` files.

Migrating from WebWise A.01.00

HP WebWise MPE/iX Secure Web Server version A.03.00 was designed to be a drop-in replacement for Apache, and does not attempt to upgrade or migrate any files from the WebWise A.01.00 `/APACHE/SECURE` directory tree.

You must manually use the A.03.00 `*.sample` files in the `/APACHE/PUB/conf` directory tree to create new standard configuration files, and then propagate any local customization that you made in the A.01.00 `/APACHE/SECURE/conf` directory tree.

You will need to copy your server key and certificate from the old A.01.00 locations of `/APACHE/SECURE/conf/ssl.key/server.key` and `/APACHE/SECURE/conf/ssl.crt/server.crt` to the new A.03.00 locations of `/APACHE/SECURE/conf/ssl.key/server.key` and `/APACHE/SECURE/conf/ssl.crt/server.crt`.

Any A.01.00 CGI applications in `/APACHE/SECURE/cgi-bin` or any data content in `/APACHE/SECURE/htdocs` can either be moved to the corresponding A.03.00 directories in `/APACHE/PUB`, or left in place after adjusting the new A.03.00 configuration files to refer to the old A.01.00 locations.

WebWise A.01.00 accessed web page content as the user `SECURE.APACHE`, but WebWise A.03.00 accesses web page content as the user `www.APACHE`. This is the same user as used by Apache A.02.00.

2 Patch Information for MPE/iX 7.5 PowerPatch 2

The following table provides a list of patch index numbers and a description of the patch.

Patch Index	KPR Number	Description
ACCHD86A	8606-302747	GENERAL FIXES FOR ACC COMMON ON MPE/IX 7.5 (C0) PATCH
	8606-239912	
	8606-292154	Supersedes: ACCHD24A ACCGDX8A
	8606-279496	
	8606-298352	
	8606-309694	
	8606-344129	
	8606-359842	
	8606-359806	
ARMMX56B	8606-214147	ARMSERVER ALIGNMENT TRAP
	8606-212870	
BBXMXA3C	8606-268101	BUSINESS BASIC/IX COMPILER A.00.24: FIX BUGS IN SELECT
	D500-154029	
COBMXJ7C	8606-315718	COBOL II/IX OPTIMIZE=1 CAN CAUSE DATA CORRUPTION (BLANKED BYTE)
		Supersedes: COBMXB0C
CONGDU3A	5003-164293	GENERAL FIXES FOR NIO CONSOLE ON MPE/IX 7.5 (A) PATCH
	8606-214376	
DCCHD72A	8606-348848	GENERAL FIXES FOR DCCONFIG ON MPE/IX 7.5 (C) PATCH
	8606-319268	

Patch Information for MPE/iX 7.5 PowerPatch 2

Patch Index	KPR Number	Description
	8606-262891	Supersedes: DCCHD39A DCCGDX5A
	8606-164838	
	8606-193876	
	8606-293229	
	8606-325820	
DTCGDU4A	8606-124212	7.5 DTC HOST DOWNLOADS, EQUIVALENT TO ODMGDB6, OV
	8606-179267	DTCMGR A1440E00
DTSHD53A	8606-308473	DTS 7.5 - FIX SA1457 FROM TIO_NDM
	8606-319268	
	8606-335666	Supersedes: DTSHD37A
	8606-290518	
	8606-222556	
	8606-295732	
	8606-303876	
	8606-293229	
	8606-286687	
EDTMXF7C	8606-284606	HP EDIT A.02.36: FIX PROBLEM WITH SPOOL FILE DISPLAY AND SAVE.
FRIMX47E	8606-215725	FIX FOR RPCD AND FIX FOR DBOPEN() SYMBOL IN DCEXL
	8606-232661	
FTPHD71A	8606-338048	GENERAL FIXES FOR FTP FOR 7.5 RELEASE (E2 PATCH)
	8606-343050	
	8606-344454	Supersedes: FTPHD68A FTPHD48A FTPHD44A FTPHD09A
	8606-331712	FTPGDY9A FTPGDW4A FTPGDU2A

Patch Index	KPR Number	Description
	8606-277230	
	8606-328875	
	8606-299250	
	8606-289803	
	8606-273530	
	8606-124994	
	8606-224234	
	8606-230026	
	8606-231617	
	8606-250162	
	8606-250495	
	8606-256482	
	8606-267935	
	8606-269614	
	8606-269712	
	8606-270473	
	8606-276240	
	8606-281685	
	8606-284297	
	8606-287785	
	8606-293906	
	8606-294908	
	8606-297039	
	8606-299646	
	8606-299968	
	8606-300719	
	8606-300832	
	8606-302727	
	8606-310306	

Patch Information for MPE/iX 7.5 PowerPatch 2

Patch Index	KPR Number	Description
FWSLXT5D	8606-201006	PROVIDE REV. 3728 FIRMWARE FILE FOR 28696A FW SCSI DEVICE ADAPTER
INTHD64A	8606-325249 8606-183008 8606-230083 1653-202150 8606-326191	GENERAL FIXES FOR INTERSRV PRODUCTS ON MPE/IX 7.5 (C) Supersedes: INTHD61A INTGDY3A
ITOED07D	4701-401919	PROVIDE 5.5 FUNCTIONALITY IN XL.PUB.SYS FOR 6.0 & 6.5 HP3000 ITO AGENT
LNKMXE3A	8606-287479	LINKEDIT A.06.24: FIX FOR SILENT TRUNCATION OF LONG INFO STRING.
MPELXT0C	5003-345553 4701-383950	NEW PATCH TO INCLUDE MPEJXV9(5.5), MPEKXL0(6.0), AND MPEKXX4(6.5).
MPELXT1D	8606-194199 8606-180352	NETWORK SPOOLER: 2 FIXES FOR PJL SYNTAX ERRORS, NMS 9621
MPEMX02D	8606-217821	SYSTEM HANG DUE TO 2-WAY DEADLOCK BETWEEN NETWORK SOCKET SEMAPHORES
MPEMX54C	8606-237023	POSSIBLE PROBLEMS WITH FILES CREATED WITH MKNOD COMMAND.

Patch Index	KPR Number	Description
MPEMX85D	8606-262297	SHADOW ERROR -38 AND -19 DURING ONLINE PARTIAL BACKUPS Supersedes: MPEMXL1A MPEMXJ6C MPEMXK1C MPEMXH6C MPEMXB6B MPEMX93C MPEMX64C
MPEMX91C	8606-245702	LABELED TAPES CAUSE AUTOLOADER TO SKIP TAPES BETWEEN JOBS
MPEMX94B	8606-244832	CIERR 981 IF SHELL EXIT CMD IS LAST RECORD IN JOB'S VARIABLE RECORD
MPEMXA5B	8606-269701 8606-221095 8606-274443	SA1458 DURING CREATEPROCESS DUE TO PROBLEMS HANDLING POSIX ENVIRON Supersedes: MPEMX86B
MPEMXB1B	8606-276005	:SHUTDOWN SYSTEM;RESTART CAN RESULT IN SA 1047 AFTER SHUT 6 ON 9X9,99X
MPEMXB3C	8606-278180	SA2216 FROM RUNNING OUT OF XM COPYFWD ARRAY ELEMENTS DURING CHECKPOINT
MPEMXC6B	8606-284194 8606-305917	SA1740 OR NEWMIRRSET FAILS; MIRVUTIL HANGS ON FILL_DISC_WAIT CONDITION
MPEMXC7B	8606-266613	SA 0 WITH AN INVALID VIRTUAL ADDRESS Supersedes: MPEMXK3C MPEMXM1A MPEMXL2B MPEMXE5C MPEMXA9C MPEMXB2C MPELXV3C MPEMX81B MPEMX99C MPEMX76C

Patch Index	KPR Number	Description
MPEMXD6B	8606-272806	SYSTEM ABORT 1458 OR 2559 WHEN NETWORK DISCONNECT INTERRUPTS NEWCI
MPEMXD8B	8606-288647	ALLOW LISTING OVER 100 SOMS WITH VERSION.PUB.SYS Supersedes: MPEMXC2B
MPEMXD9B	8606-288751	BX00 0127 DEAD HALT INSTEAD OF SYSTEM ABORT ON 9XX SERIES SYSTEMS
MPEMXE2B	8606-288084	ARRAYLOG -E REPORTS ERROR NUMBER : 50 AND HLIO CHAIN TABLE LEAKS.
MPEMXE6C	8606-292571	IMPROVED INTERNAL ERROR MESSAGES (SYSCAT)
MPEMXF6C	8606-267267	RESTORE/COPY OF LARGE AMOUNTS OF DATA CAN CAUSE VSM TABLE EXHAUSTION
MPEMXG0C	5003-454843	SA775 WHEN LOAD_SOM ENCOUNTERS A MALFORMED NMXL FILE Supersedes: MPEMX90D
MPEMXH2C	8606-308481	SYSTEM ABORT 16 WHEN BOOTING FROM A NEW STAGE WHICH DOESN'T CONTAIN NL

Patch Index	KPR Number	Description
MPEMXH9C	8606-230812	PROBLEMS WITH SPOOLFILES CREATED WITH POSIX APPS
	8606-310669	(FSERR 105, SA514)
	8606-310956	
	8606-318248	
MPEMXJ0C	8606-314612	HPSPoolID GIVES WRONG SPOOLFILE ID IF DUPLICATE JOB NUMBER IN SPOOLER
MPEMXJ1C	8606-300920	SADPATCH DOES NOT ACKNOWLEDGE THE CORRECT HP DIAGNOSTIC PASSWORD
MPEMXJ3B	8606-304075	SCSI MODE PAGE ENHANCEMENTS FOR FUTURE TAPE SUPPORT.
MPEMXJ5A	8606-318190	SA1334 INFO = #610 FROM FIBRE CHANNEL TIMER ENTRY RECORD
MPEMXJ9A	8606-316579	CANNOT CREATE STREAMS, FIFO OR DEVICE LINK FILES ON USER VOLUME SET Supersedes: MPEMXD1A
MPEMXK0C	8606-193185	CPUS MAY FAIL TO LAUNCH DURING BOOT ON MULTIPROCESSOR SYSTEMS
MPEMXK5B	8606-321376	OPENLOG AND CLOSELOG RECORDS INCORRECT ON 7.5 AND 7.0 WITH MPEMX24

Patch Index	KPR Number	Description
MPEMXK9A	8606-331019	HAFOERR 16 WHEN DOING AN AD WITH UNEQUAL STRING LENGTH PATH IDS Supersedes: MPEMXG9C
MPEMXL0A	8606-332175	NATIVE FIBRE CARD CHIP FREEZES - SAME AS HPUX CR 8606235253 Supersedes: MPEMXK4A MPEMXE4A
MPEMXL6B	8606-337965	OS DAT/DEBUG MACRO FIXES AND ENHANCEMENTS 8606-297155 8606-302492 8606-327251 8606-146338 8606-334232 8606-214092
MPEMXL8A	8606-339373	SA732 OR SYSTEM HANG ON UNIPROCESSOR A/N USING NATIVE FIBRE CHANNEL
MPEMXL9C	8606-335372	ENHANCEMENT TO REDUCE PER PROCESS VSM OBJECT/TABLE USAGE BY AIF:PE
MPEMXM0A	8606-325444	SA1050 WHEN ABORTING AN I/O REQUEST QUEUED TO SE OR F/W SCSI DAM
MPEMXM7A	8606-338470	DAT FAILS TO OPEN DTOD DUMP WHEN LIMIT IS A MULTIPLE OF 4096MB

Patch Index	KPR Number	Description
MPEMXM8A	8606-344983	HFS DIRECTORY CAN BE CORRUPTED AFTER SF OR INCOMPLETE SHUTDOWN
MPEMXM9A	8606-347543	HAFO ERROR 1012 AND LDEV 1 IN FAILED FAILOVER STATE AFTER SLT UPDATE Supersedes: MPEMXM2C MPEMXL5B MPEMXK7B MPEMXH5C MPEMXH0B MPEMXG4B MPEMXE1A MPEMXF8B MPEMXE7A MPEMXE8B MPEMXA1C MPEMXD5B MPEMXA8B MPEMXD2A MPEMXC8A MPEMXA7B MPEMX61B
MPEMXN6B	8606-355072	SYSTEM HANG CAN OCCUR WHEN PERFORMING I/O FOR LARGE FILES (>4GB) Supersedes: MPEMXQ1C
MPEMXN8C	8606-355961	SA1457 CAN OCCUR DUE TO A HLIO IO_BUCKET_TABLE FREE LIST PROBLEM Supersedes: MPEMXG1C MPEMX92C
MPEMXP0A	8606-356250	KSAM64 FILES CAN FILL UP DESPITE THE USE OF REUSE OPTION
NMCHD36A	8606-319268	GENERAL FIXES FOR NMMGR ON MPE/IX 7.5 (D) PATCH
	8606-264154	
	8606-255163	Supersedes: NMCHD17A NMCGDY2A NMCGDU6A
	8606-252900	
	8606-268698	
	8606-234603	

Patch Index	KPR Number	Description
NMSHD79A	8606-351808	GENERAL FIXES FOR NMS/IX ON 7.5 (E PATCH)
	8606-339405	
	8606-319268	Supersedes: NMSHD70A NMSHD35A NMSGDV1A NMSGDU5A
	8606-195035	
	8606-207282	
	8606-274274	
NRCMXN4C	8606-352235	SUPPORT TOOLS UPDATE (ODUMP, CHKDTOD, DUMPCOPY)
		Supersedes: NRCMXH1C NRCMXB8C
NSRGDU7A	8606-147395	GENERAL FIXES FOR DOMAIN NAME SERVICE ROUTINES ON 7.5 (A0 PATCH)
NSTHD06A	1653-296426	GENERAL FIXES FOR NS TRANSPORT ON MPE/IX 7.5 (A2)
	8606-106004	PATCH
	8606-174426	Supersedes: NSTHD02A NSTGDW6A
	8606-174449	
	8606-200275	
	8606-217960	
	8606-232667	
	8606-241875	
	8606-249651	
	8606-254218	
	8606-257335	
	8606-267660	
	8606-269347	
	8606-272847	
	8606-285610	

Patch Index	KPR Number	Description
	8606-286850	
	8606-297205	
ODBMXH7C	8606-318396	ODBCLINK/SE VERSION G.02.00 FOR 6.5 7.0 AND 7.5
		Supersedes: ODBMXG6C ODBMXE0C ODBMXD4C ODBMXB9A
ODIMXN2C	8606-349534	STM ONLINE DIAGNOSTICS B8343AA.75.05 GENERAL UPDATE
	8606-344345	RELEASE
		Supersedes: ODIMXL3C ODIMXE9C ODIMX96C
ODMHD45A	8606-319268	OVDTCMGR PC BASED 14.4 PATCH E00 WITH HOST-BASED
	8606-179267	MIGRATION TOOL
	8606-124212	
	5000-716183	
	5003-365064	
	1653-228684	
	1653-231787	
	5003-360669	
OSPMXH3C	8606-308761	MAM3184MC AND MAM3367MC DISKS, SYSSTART INSTALL MODS,
	8606-307570	
	8606-301078	Supersedes: OSPMXF4C
	8606-316246	
PARMX97C	8606-225011	PASCAL/IX LIBRARY A.05.05.04: FIX TRAP ON OPENING PIPE
PBTHD88A	8606-344129	GENERAL FIXES FOR PCI 100BASE-T ON MPE/IX 7.5 (A0)
	8606-337334	PATCH

Patch Information for MPE/iX 7.5 PowerPatch 2

Patch Index	KPR Number	Description
PTDGDX9A	8606-250491	GENERAL FIXES FOR TELNET ARPA SERVICES ON 7.5 (B
	4701-422436	PATCH)
	8606-264334	Supersedes: PTDGDT9A
	8606-259714	
	8606-175456	
	8606-250349	
	8606-219917	
	8606-219640	
RPGMXJ8C	8606-320424	RPG/IX A.00.21 CUMULATIVE PATCH
SCOMXN1C	8606-356541	MI CNTR OVERFLOWS CAUSING NEGATIVE NUMBERS IN
	8606-335213	EXTRACTED/EXPORTED DATA
	8606-307580	Supersedes: SCOMXK8C SCOMXH4C SCOMXD7C
	8606-288807	
	8606-278192	
	8606-248924	
	8606-172760	
SMBMXG3C	8606-304287	SAMBA 2.2.8A FOR MPE 6.5, 7.0, AND 7.5 TO SUPPORT
		ENCRYPTED PASSWORDS
SMLHD16A	8606-304094	SENDMAIL A.01.02 FOR MPE/IX 7.5 (B) PATCH
	8606-301101	
		Supersedes: SMLHD04A
SNMGDT6A	8606-272894	GENERAL FIXES FOR SNMP ON MPE/IX 7.5 (A PATCH)
	8606-248966	

Patch Index	KPR Number	Description
STRGDX6A	8606-245179	GENERAL FIXES FOR STREAMS/IX ON MPE 7.5 RELEASE (B
	8606-245307	PATCH)
	8606-252710	Supersedes: STRGDU8A
	8606-212542	
	8606-134134	
TIXMXD0A	8606-284008	GB FILE LEFT OPEN EVEN NO ACCESSOR TO THE DATABASE.
		Supersedes: TIXMXA4A
TSMHD38A	8606-319268	TERMDSM PATCH FOR MPE/IX C.75.00 (B PATCH)
	8606-286262	
		Supersedes: TSMGDV2A
VPL LX49E	8606-131968	VPLUS WITH ARB ENABLED RETURNS YEAR '00' AS 'A0' AND
		'10' AS 'B0', ETC
XPMMX65C	8606-249488	FIX TO HP SURESTORE E RAID MANAGER XP (RM) UTILITIES
		FOR ERR 242

